
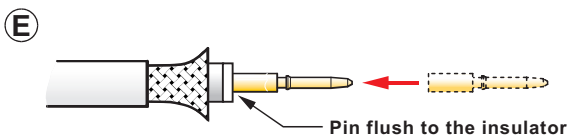
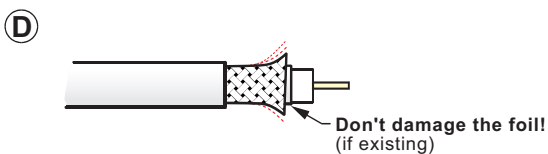
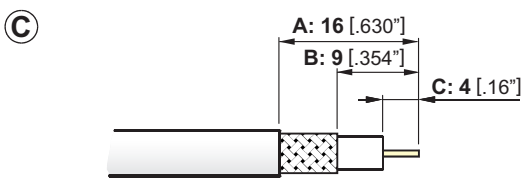



Rear Twist BNC

75Ω Cable Connector

Crimp version


Assembly Instructions

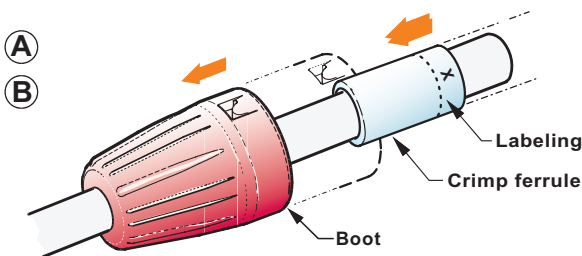

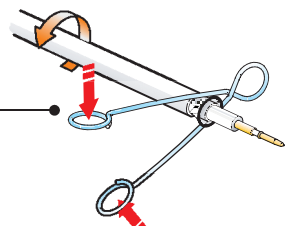- A** Slide the boot onto the cable
- Position the labeling to the cabelend
- B** Slide the crimp ferrule onto the cable
- C** Prepare cable as shown
- Use an adjustable coaxial cable stripper
- D** Spread the braided shield
(It's easily with the NEUTRIK® "SHIELD-SPREADING-TOOL"!) 

- E** Crimp the pin
- position the pin on the center conductor
- Crimp the pin with the tool
(For best crimping-results it is recommended to use the original Neutrik crimp tool
- HXBNC with the corresponding insert
or hexcrimp acc. to IEC 803-W (SW 1.7)
or squarecrimp acc. to IEC 803-2 (SW 1.6)
- Pin can also be soldered (Optional!)

- F** Insert the cable into the connector body
- G** Slide the crimp ferrule over the shield to the front and push the cable and leading ferrule to it's end position until you hear a snap noise.

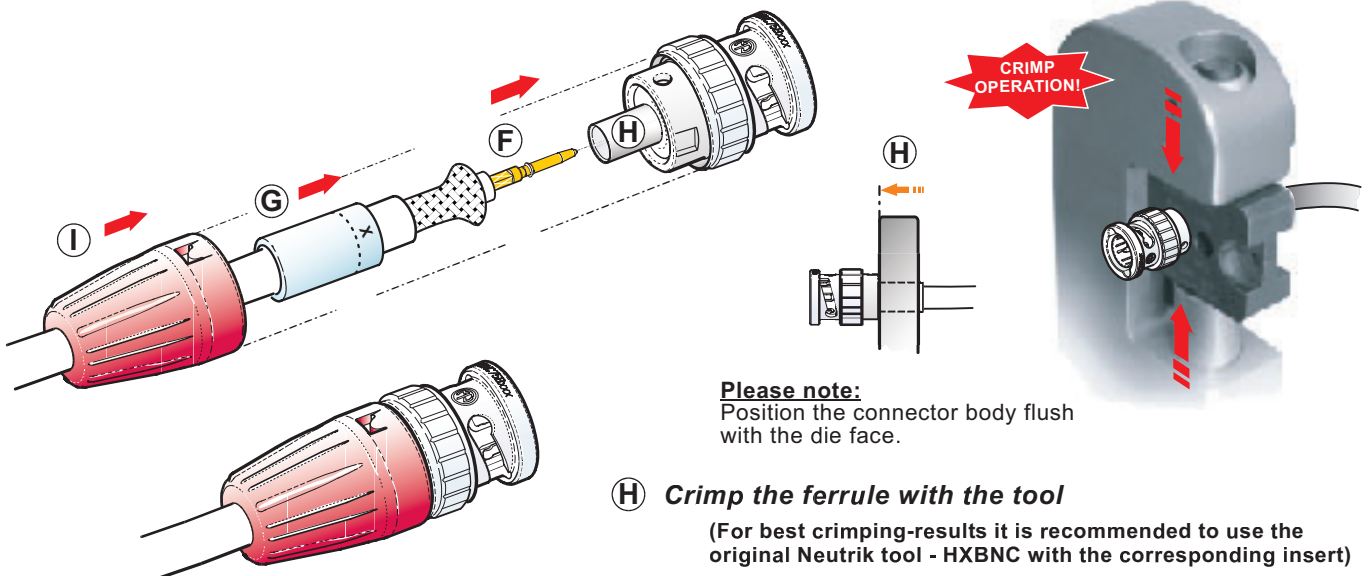

Please note:
Position the connector body flush with the die face.

- H** Crimp the ferrule with the tool
(For best crimping-results it is recommended to use the original Neutrik tool - HXBNC with the corresponding insert)
- I** Snap the boot onto the connector body

NEUTRIK AG Liechtenstein Tel.: +423/237 24 24 Fax: +423/232 53 93 www.neutrik.com	NEUTRIK Zürich AG Switzerland Tel.: +41 1/736 5010 Fax: +41 1/736 5011	NEUTRIK (UK) Ltd. Great Britain Tel.: +44 1983/811 441 Fax: +44 1983/811 439	NEUTRIK USA INC. USA Tel.: +1 732/901 9488 Fax: +1 732/901 9608	NEUTRIK Tokyo Ltd. Japan Tel.: +81 3/3663 4733 Fax: +81 3/3663 4796	NEUTRIK France France Tel.: +33 1/4131 6750 Fax: +33 1/4131 0511	NEUTRIK Vertriebs GmbH Germany / Netherlands Tel.: +49 8131/28 08 90 Fax: +49 8131/28 08-30
--	--	--	---	---	--	---

Draft Nr.: BDA 076 / 3102M0771
Update: 22.09. 2004

Data subject to change without prior notice. ©2004NEUTRIK®. ALL RIGHTS RESERVED.



NEUTRIK®
CONNECTING THE WORLD