
XLR Cable Connector

NC*FRX & NC*MRX

Assembly Instructions

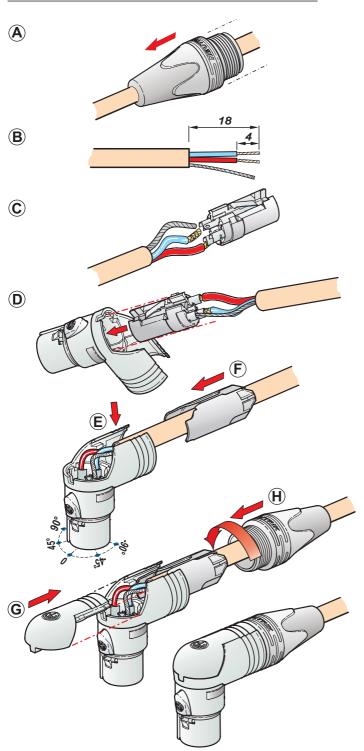

- (A) Slide the boot onto the cable.
- (B) Prepare cable as shown.
- (C) Insert wires into the terminals and solder
- (D) Slide insert into the housing until it snaps in.

Align insert with housing.

- (E) Position the cable.
- (F) Slide the chuck into the housing.

Pay attention to position chuck as shown.


G Position the cover.

Before place the cover choose the orientation of cable outlet by turning housing.

(H) Finish the installation by turning the bushing onto the connector.

Disassembly of the insert

- (I) Remove cover and chuck.
- (J) Push latch and turn housing approx. a half turn until housing can be separated.
- (K) Lift the locking clip by help of a screw driver.
- (L) Remove insert.

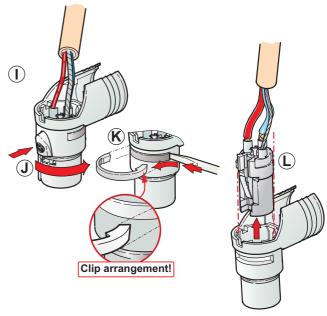

NEUTRIK AG **NEUTRIK Zürich AG** NEUTRIK USA Inc. **NEUTRIK (UK) Ltd.**

T: +423/2372424 T: +41 44 / 736 5010 F: +41 44 / 736 5011 T: +1732/9019488 F: +1732/9019608

Update: 15.11.2007

F: +423 / 232 53 93 **NEUTRIK Vertriebs GmbH NEUTRIK France NEUTRIK Tokyo Ltd.** NEUTRIK Hong Kong T: +44 1983 / 811 441 F: +44 1983 / 811 439

FR JΡ

DE/NL/AT T: +49 8131/280 890 F: +49 8131/280 830 T: +33 1 / 4131 6750 F: +33 1 / 4131 0511 T: +81 3 / 3663 4733 F: +81 3 / 3663 4796

www.neutrik.com

Draft. Nr.: BDA 173-0 / 3102M1441

ш

CH

USA



